



Profile M - Cross Section at Station E18
 January 7, 2009 Bear Trail Debris Flow
 Maggie Valley, Haywood County, NC

Bearing = 265 degrees
 View looking upslope

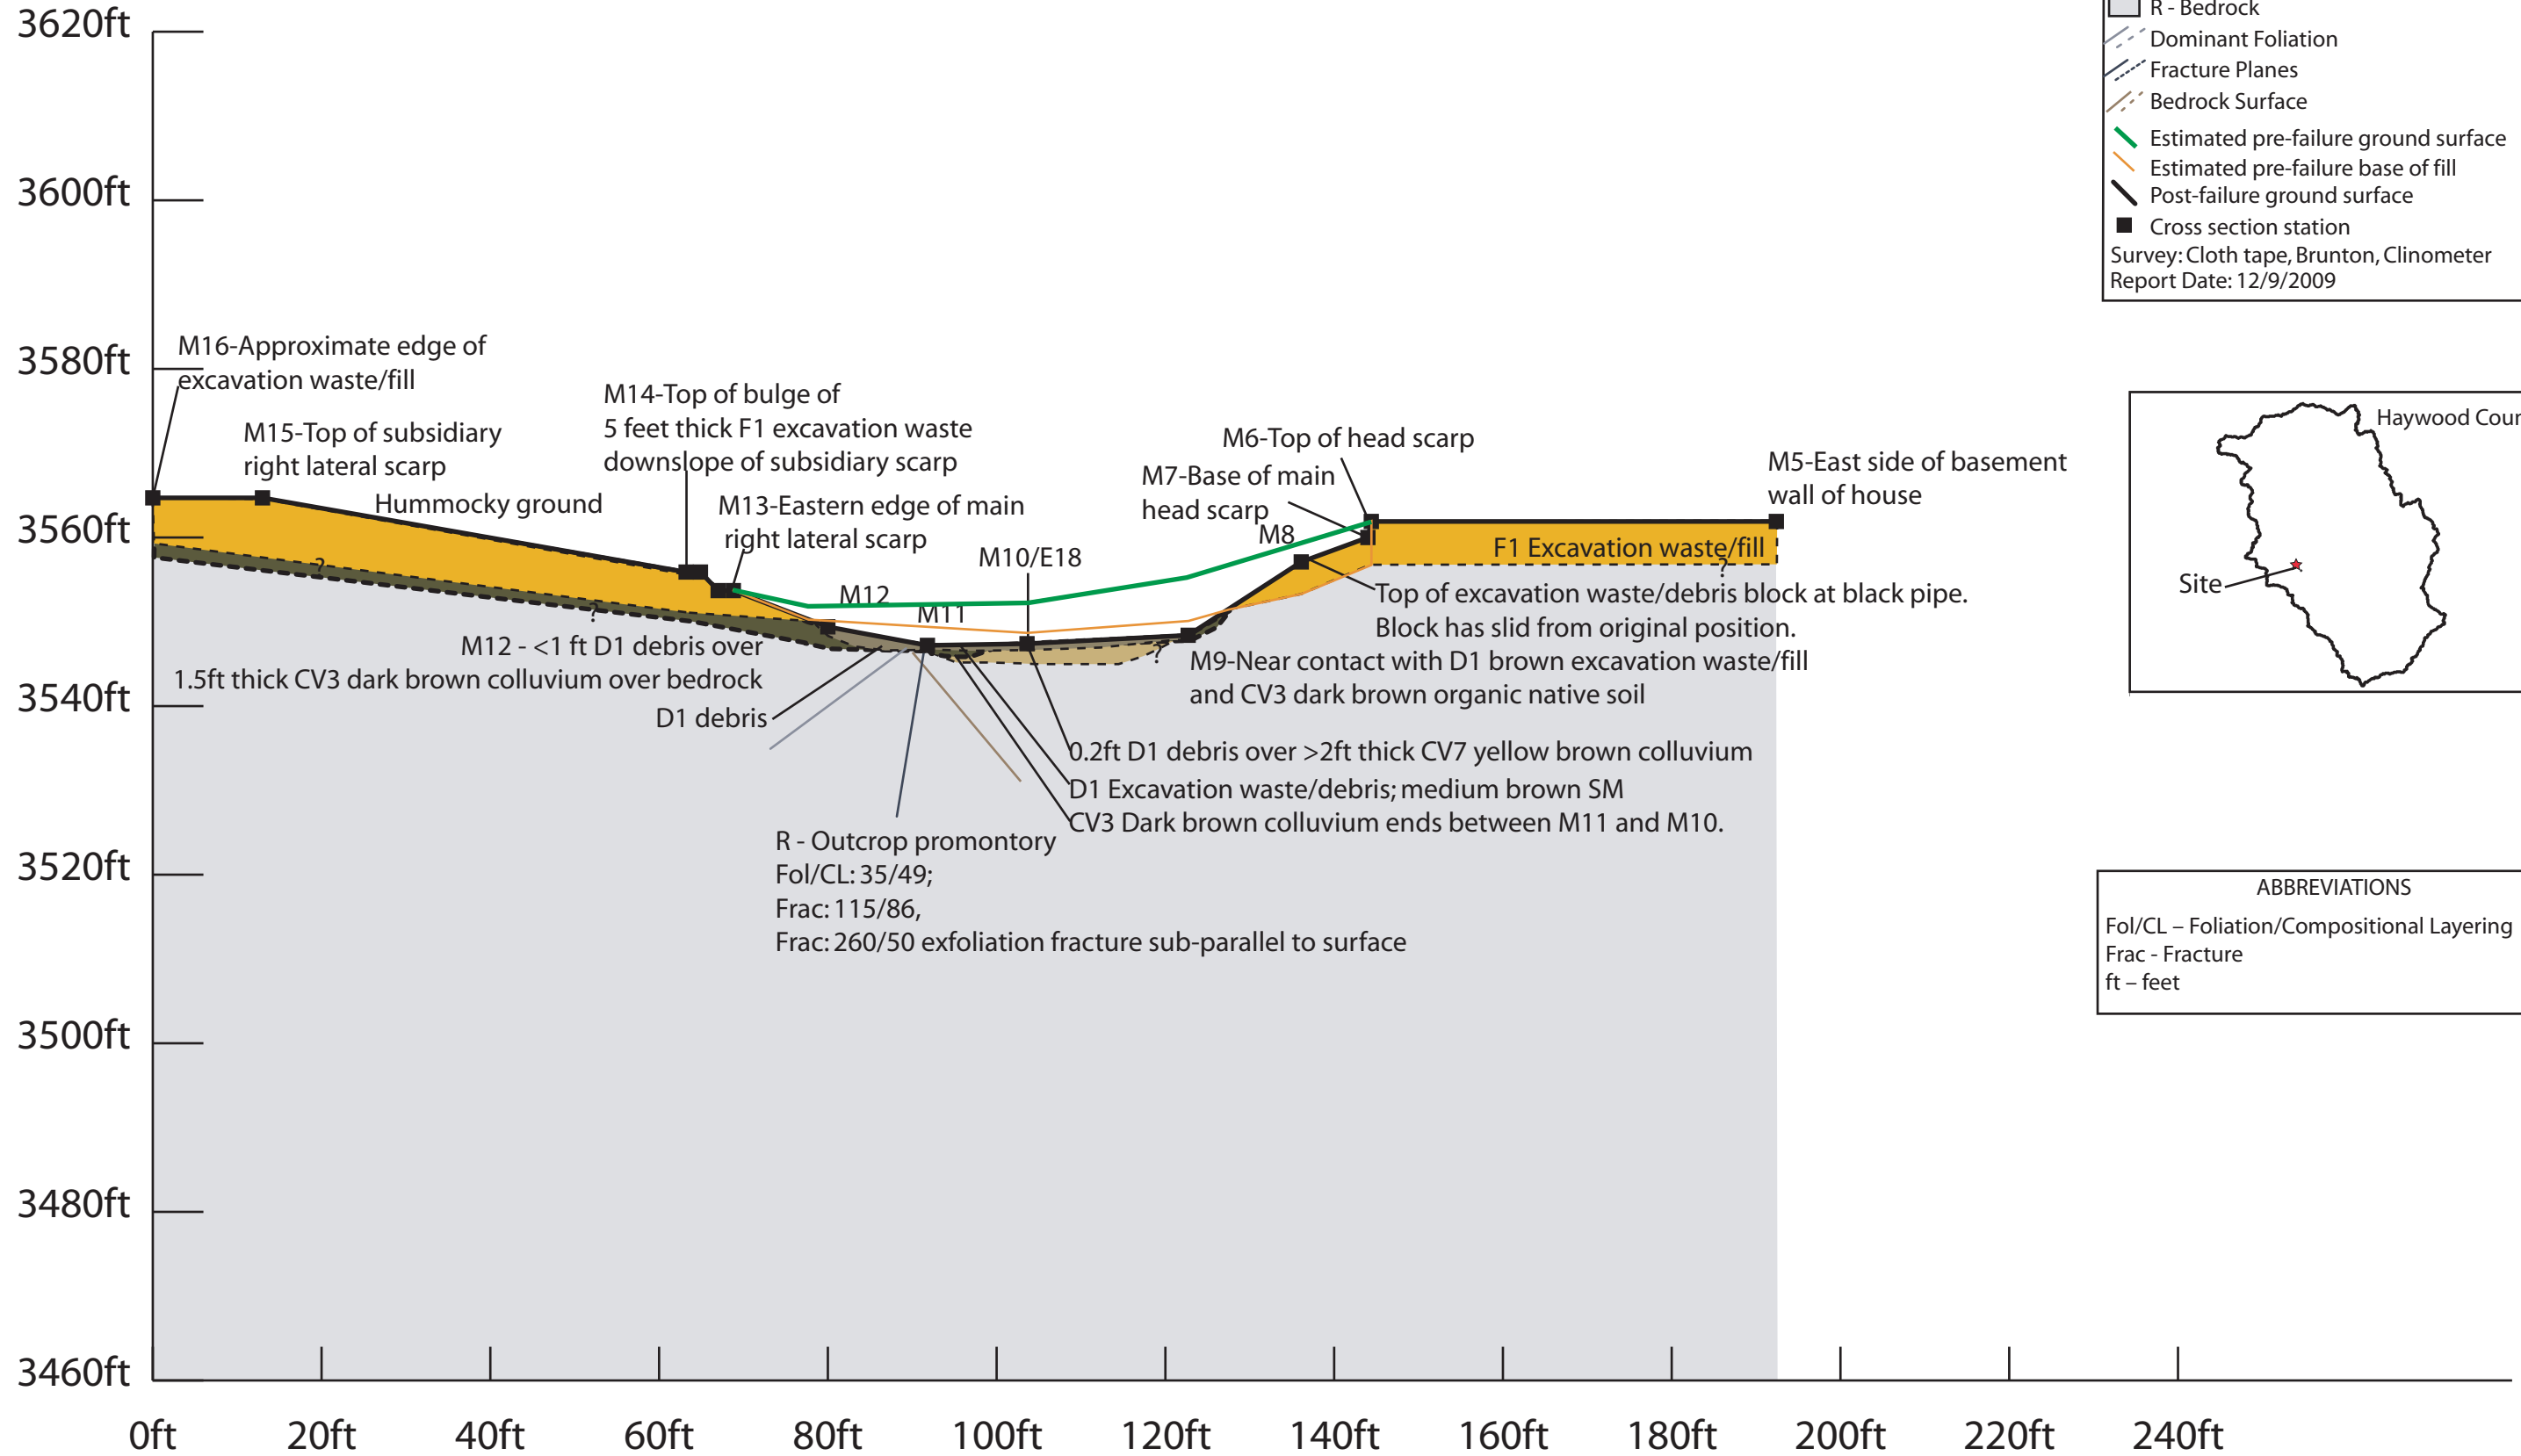

EXPLANATION	
	D1 - Debris from January 7, 2009 Debris Flow
	F1 - Excavation Waste/Fill
	CV3 - Colluvium, medium to dark brown ML/SM with clay and g, organics
	CV7 - Colluvium, yellow brown SM
	R - Bedrock
	Dominant Foliation
	Fracture Planes
	Bedrock Surface
	Estimated pre-failure ground surface
	Estimated pre-failure base of fill
	Post-failure ground surface
	Cross section station
Survey: Cloth tape, Brunton, Clinometer	
Report Date: 12/9/2009	

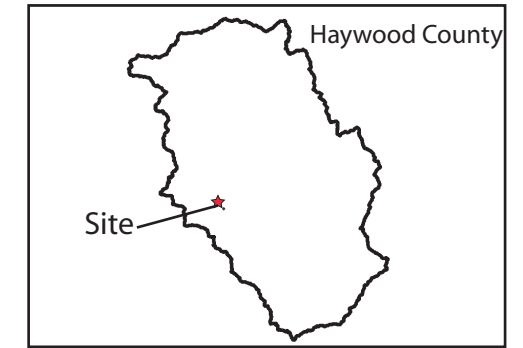

ABBREVIATIONS	
Fol/CL	- Foliation/Compositional Layering
Frac	- Fracture
ft	- feet